

KENWOOD

#871

SERVICE BULLETIN

AMATEUR RADIO

SUBJECT

TR-9130 Low Drive Level

DATE

7-05-83


For reported cases of low transmit power output check the level of the TX driver transistor Q7 of the DRIVE unit (X47-1090-00). If the TX drive level is low make the following changes.

Old Part

Q7: 3SK97 (Q1)
R36: 100 Ω

New Part

3SK122 (L)
68 Ω (RD14BB2E680J)

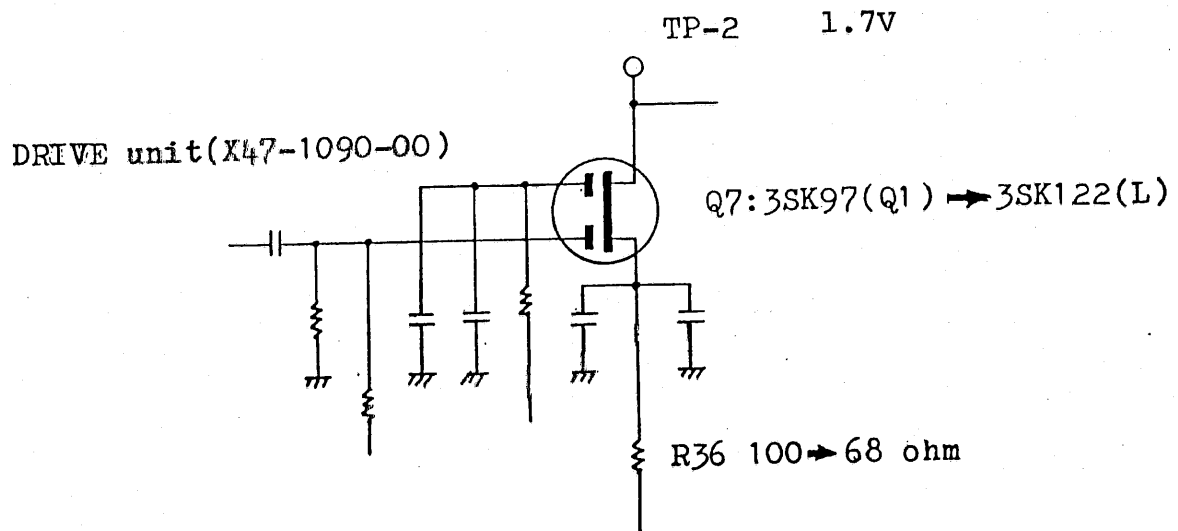

Time required for this change is $\frac{1}{2}$ hour.

CLM

TRIO-KENWOOD COMMUNICATIONS

1111 WEST WALNUT STREET - COMPTON, CALIFORNIA 90220 U.S.A.
MAILING: P.O. BOX 7065 - COMPTON, CALIFORNIA 90224
TELEPHONE: (213) 639-9000 SERVICE TELEPHONE: (213) 639-7140