


Amphenol

N 型连接器 (配 1/2" 超柔电缆) 安装说明



Installation instructions of N type connector for 1/2" Superflexible cable

AFA12-4


ITEM : 14040150

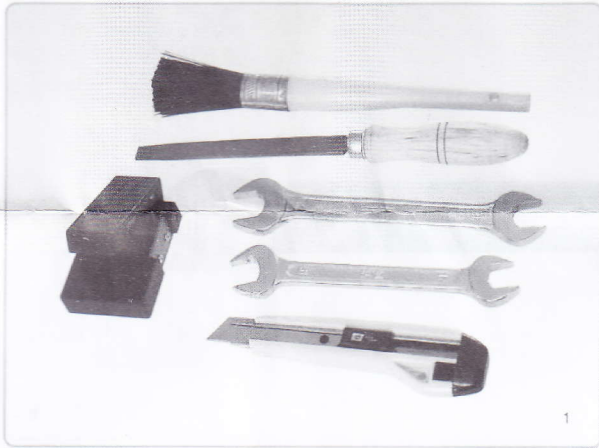


推荐安装用具
Assembly tools (recommended).

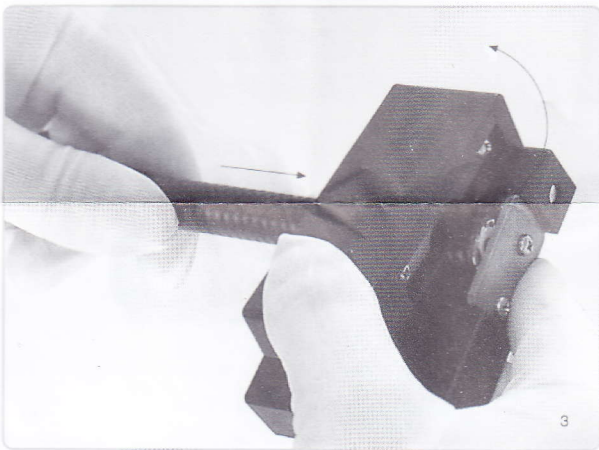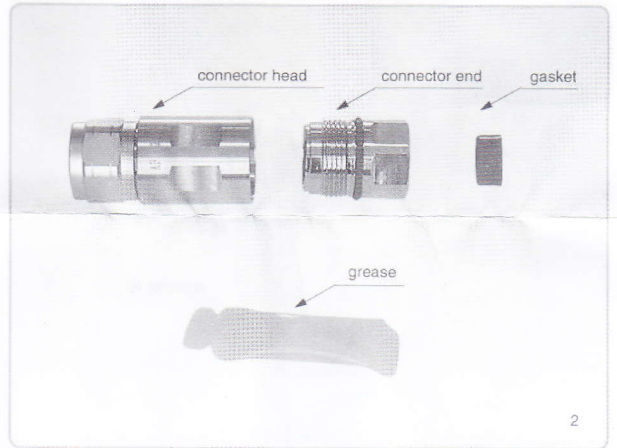

剥线
Trim the cable jacket.

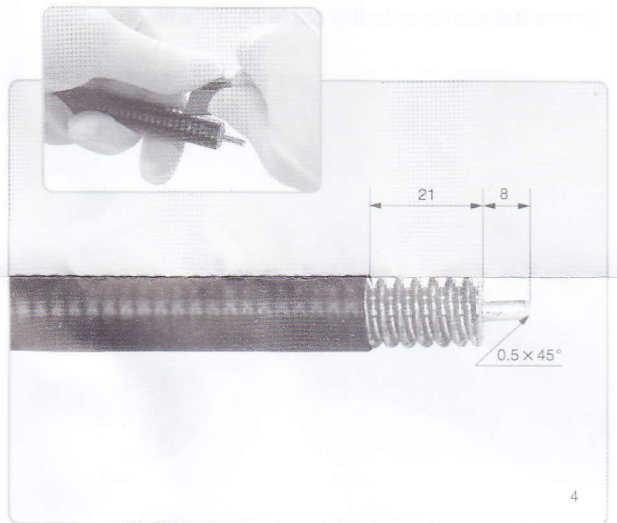

剥线尺寸如图, 用板锉倒角并去毛刺。
Trim the cable at the position acc.to the fig. Chamfer inner conductor with flat file and smooth it.

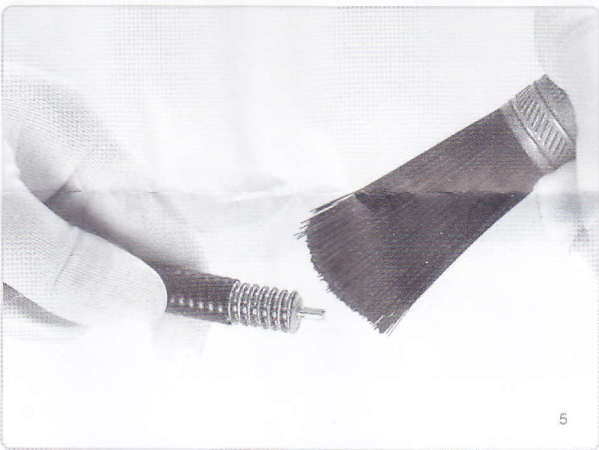

清除碎屑
Clean the sawing edge with brush.



套上密封圈并涂上油脂
Put the gasket onto the cable and then wipe the gasket with the grease.


Amphenol

N 型连接器 (配 1/2" 超柔电缆) 安装说明


Installation instructions of N type connector for 1/2" Superflexible cable

AFA12-4


ITEM : 14040150

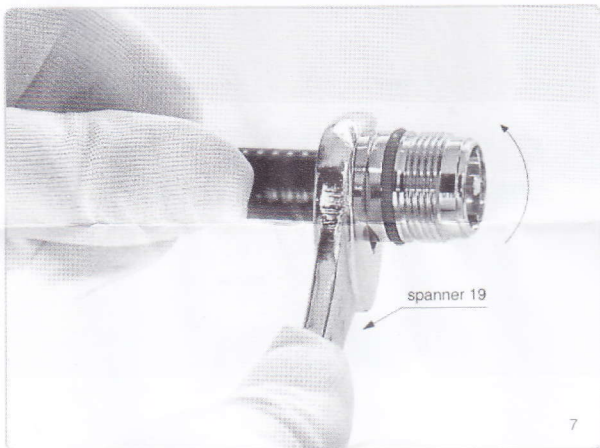

将电缆夹旋到电缆上，直到拧不动为止
Screw the clamp onto the cable tightly with spanner.

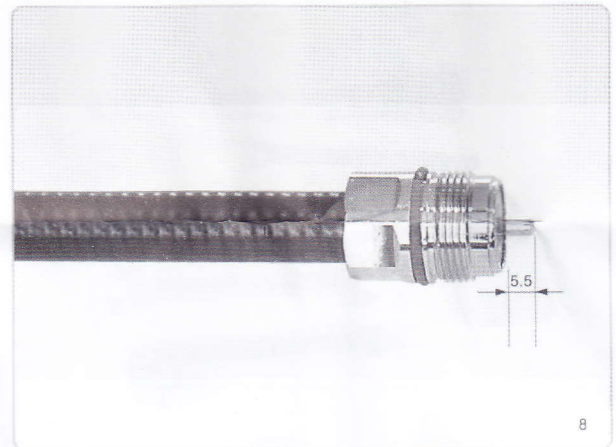


确认安装尺寸
Verify the dimension as shown.

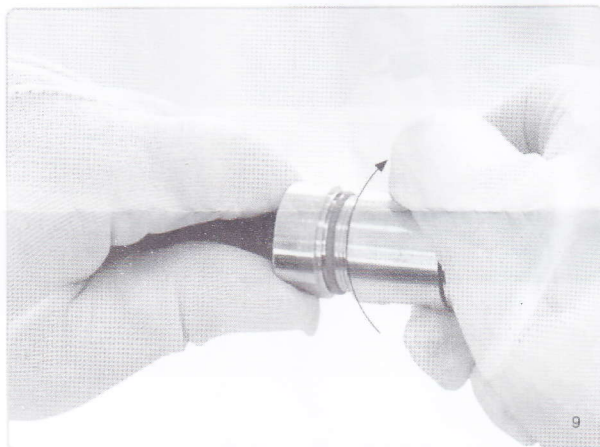


旋上前壳体
Screw the connector head onto the clamp.



推荐扭矩为 25 Nm，最小破坏扭矩为35N.m
The recommended torque is 25 N.m. The min. breakdown torque is 35 N.m

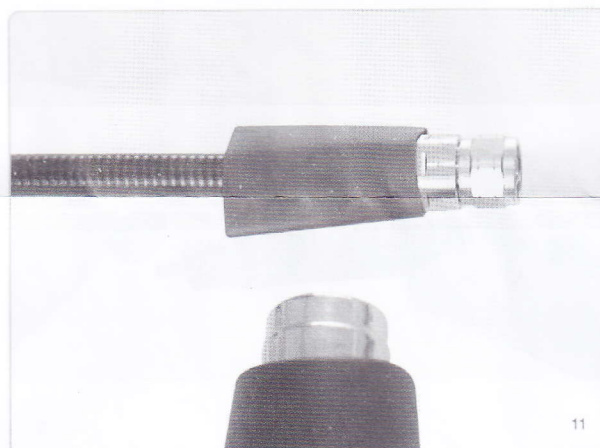

吹封热缩套管
Put on the heat shrink tube and heat it.

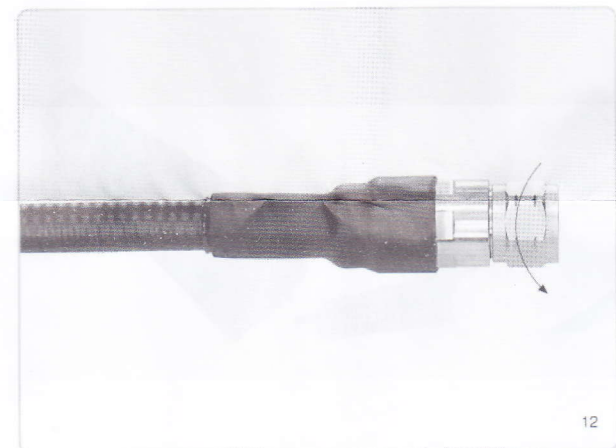

推荐配合扭矩 1.7-2.3Nm(与插座相配)
Copulate torque (recommended) is 1.7-2.3N.m.